SRB CRITICAL ITEMS LIST

SUBSYSTEM: ELECTRICAL AND INSTRUMENTATION

ITEM NAME: SRB OF Watertight Reusable Cable X13W2R P1/P2 and X13W3R P1/P2 (Orbiter Bus A and Bus B

Power - Hydraulic Fluid Reservoir Excite Voltage)

PART NO.: 10400-0018

10400-0019

FM CODE: A06

ITEM CODE: 50-04-X13 REVISION: Basic

CRITICALITY CATEGORY IR REACTION TIME: Immediate

NO. REQUIRED: 1 each DATE: March 1, 1995

CRITICAL PHASES: Boost, Separation SUPERCEDES: March 1, 1994

FMEA PAGE NO.: D-664 ANALYST: R. Smith/A. Craft

SHEET 1 OF 2 APPROVED: P. Kalia

FAILURE MODE AND CAUSES: Loss of Orbiter Bus A and B power in both cables due to:

 One pin or wire short to ground caused by: bent pin, contamination in connector, insulation breakdown, frayed shielding, abraded or cur insulation.

FAILURE EFFECT SUMMARY: Boost: Loss of mission, vehicle and crew due to loss of TVC.

Separation: Loss of SRB Separation leads to vehicle breakup resulting in loss of mission, vehicle and crew.

One success path remains after the first failure. Operation is not affected until both paths are lost.

REDUNDANCY SCREENS AND MEASUREMENTS:

- Pass All cables are system tested during ground turnaround sequence.
- Pass Bus A and B voltage measurements B76V1600C and B76V1601C.
- Pass No credible causes.

FM Code: 50-04-X13-A06 Date: March 1, 1995
RATIONALE FOR RETENTION:

- A. DESIGN Per Appendix A Section # []
- B. TESTING
 - 1) VENDOR RELATED Per Appendix B Secuon # [A
 - 2) KSC RELATED Per Appendix B Section # IIB
 - 3) SYSTEM/ UNIQUE FUNCTIONAL

After transfer to SPC, cables are tested during SRB Strut Electrical Mate per OMRSD File V. Vol. 1. requirement numbers B75BU0.010 (SRB Bus Isolation Test).

Cables are also tested during SIT per OMRSD File II, Vol. 1, requirement number S00000.470 (Orbiter/SRB Power Transfer Buses A and B). (Short)

- C. INSPECTION
 - 1) VENDOR RELATED Per Appendix C Section # [(Soldered Connector)
 - 2) KSC RELATED Per Appendix C Section # 111
- D. FAILURE HISTORY

Failure Histories may be obtained from the PRACA database.

E. OPERATIONAL USE

Not applicable to this failure mode.

Supercedes: March 1, 1994 DR Document: RA-21